

Technical Bulletin



DP02	TB0009-2007	Elan Motorsports Technologies	
From:	Chip Lewis		
Subject:	Fuel Filter Bracket Vibration Isolation	Date:	January 18th, 2007

Attention all Elan DP02 teams

Elan Motorsports Technologies has identified an issue with the mounting of the fuel filter bracket on the DP02 engine. The direct mounting of the bracket to the engine, is leading to damage to the following parts:

1. Filter Bracket
2. Fuel Filter
3. Jiffy-Tite Connector

In order to prevent this damage, EMT is making available, through Comprent Motorsports, anti-vibration mounts for the bracket. The mounts will fit between the cam cover and the fuel filter bracket. Due to the unavailable nature of M5 mounts, the provided mounts will be 10-32 male/male. Please install the mounts with Loctite 242 (Blue) into the cam cover mounts. Please contact Comprent Motorsports for the following parts:

1. PZ-0373, qty. 4
2. PA-0001, qty. 4

Comprent Motorsports
125 Paradise Blvd.
Athens, GA 30607
(706) 543-1797