

Technical Bulletin



DP02	TB0037-2010	Elan Motorsports Technologies	
From:	Andrew Leefe Kendon		
Subject:	<i>Lens Cover</i>	Date:	June 10th, 2010

Attention all Elan DP02 teams

EMT has been informed that some DP02 lens covers have been cracking in service.

Upon investigation of the lenses returned, it would appear that the cracking is being propagated from the use of countersunk fixing holes. EMT recommends that only through holes should be used on the lenses, and that dome head screws should be used to secure the lenses in position. In addition, if the teams are not already doing so, a foam strip should be used to act as cushioning on the mounting face of the lens, either adhered to the lens itself, or to the lens recess in the wing.

Andrew Leefe Kendon
Senior Design Engineer.

If you have any questions please contact Kevin@comprent.net