


Technical Bulletin



DP02	TB0005-2006	Elan Motorsports Technologies	
From:	Christian Rushforth		
Subject:	Fire Bottle Mounting	Date:	November 20 th , 2006


Attention all Elan DP02 2006 teams

Elan has identified an issue with the fire bottle mounting and hose clip installation on cars #1 through to #15. After some periods of running the hose clips holding the fire bottle to mount may break causing the fire bottle to become detached in-turn leading to loss of extinguishment

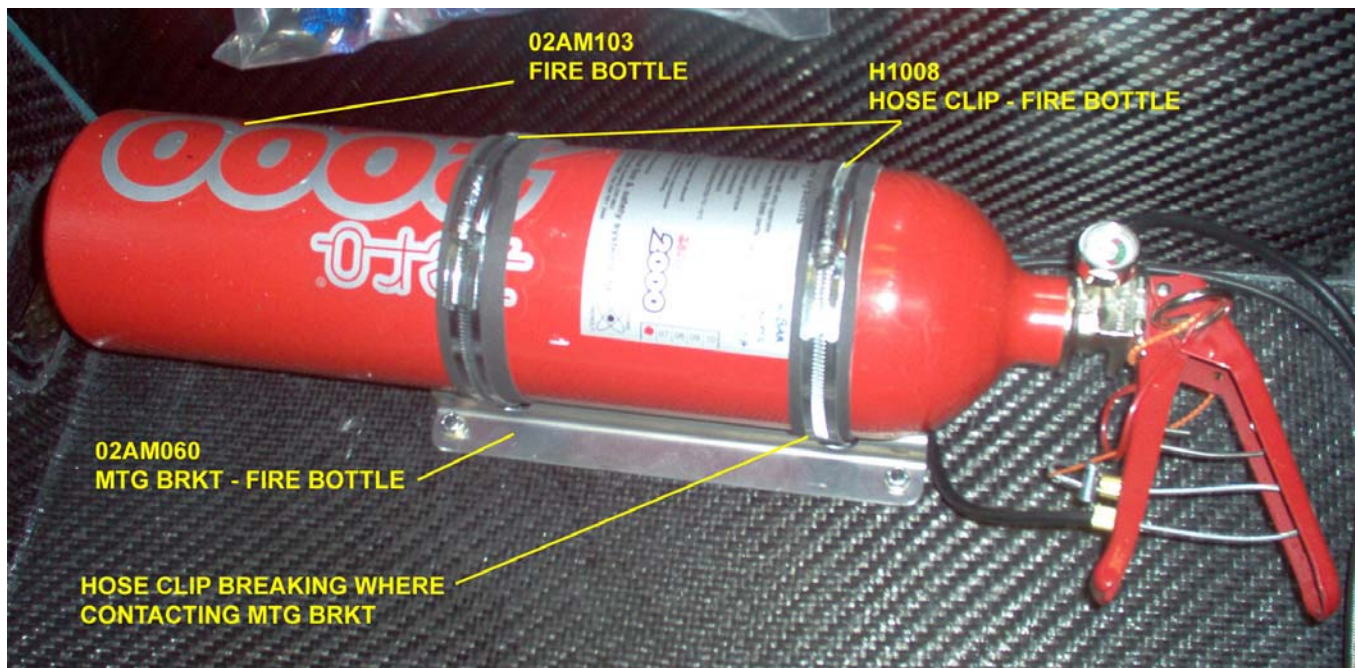

It is recommended that all teams modify their fire bottle mounting and clips to the following specification

1. Through holes in fire bottle mounting bracket to be enlarged and made square so that the hose clip does not contact on two points. Current holes are circular in manufacture which aggravates the issue of the band clamp picking up.
2. Line fire bottle mounting bracket and underneath hose clamps with approx. 1/8" thick foam
3. Hose clamps that may come into contact with mounting bracket to have heat shrink material added to them.
4. Do not over-tighten band clamps

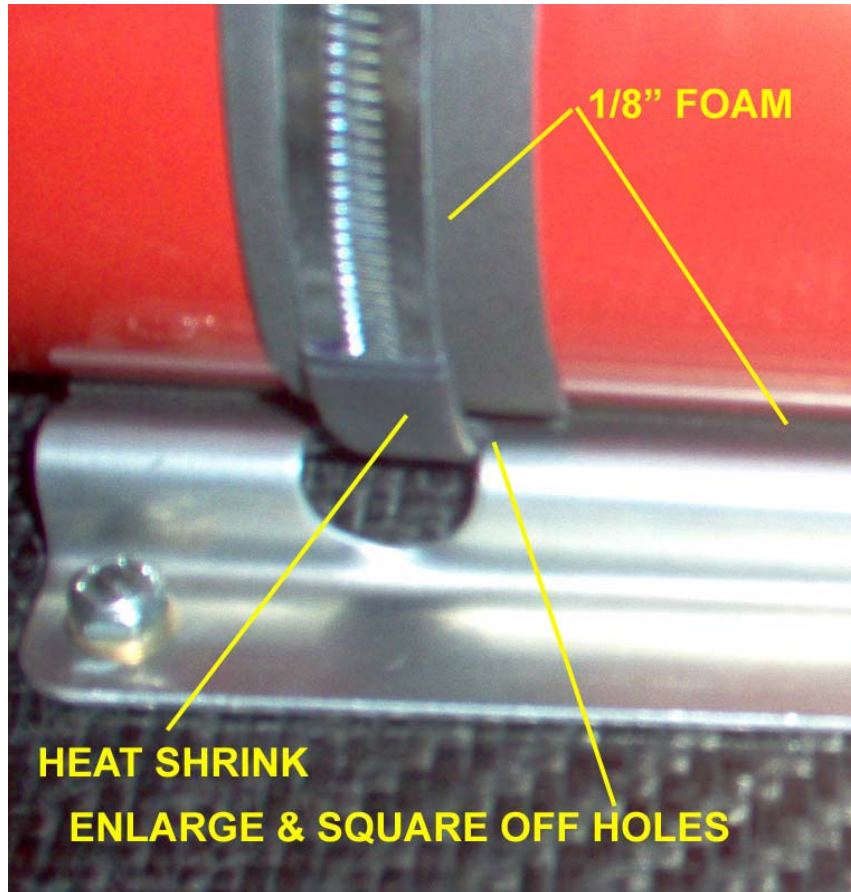

Notes: All cars #16 onward will already have this modification performed before delivery to customers